



FAG

HS7024-E-T-P4S-UL

High speed spindle bearing

High speed spindle bearing HS70...-E, adjusted, in pairs or sets, contact angle $\alpha = 25^\circ$, restricted tolerances

Informacje techniczne




Twoja aktualna wersja produktu

Contact angle	E	Contact angle 25°
Sealing	Without	Not sealed
Cage	T	Laminated fabric cage
Tolerance class	P4S	Tolerance class P4S, FAG standard better than P4 to ISO 492:2023
Arrangement bearing set	U	Single bearing
Preload class	L	Preload light

Main Dimensions & Performance Data

d	120 mm	Bore diameter
D	180 mm	Outside diameter
B	28 mm	Width
C _r	46.500 N	Basic dynamic load rating, radial
C _{0r}	38.500 N	Basic static load rating, radial
C _{ur}	3.300 N	Fatigue load limit, radial
n _{G Grease}	9.500 1/min	Limiting speed for grease lubrication
n _{G Oil}	14.000 1/min	Limiting speed for oil lubrication
n _G	14.000 1/min	Limiting speed
≈m	2,22 kg	Masa

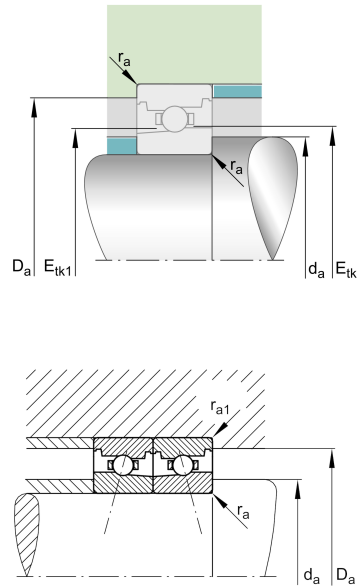



Mounting dimensions

d _a	131 mm	Diameter shaft shoulder
d _a	h12	Diameter shaft shoulder clearance
D _a	169 mm	Shoulder diameter outer ring
D _a	H12	Shoulder diameter outer ring clearance
r _a max	2 mm	Maximum recess radius
r _{a1} max	1 mm	Maximum recess radius
E _{tk} min	143,3 mm	Minimum diameter injection pitch
E _{tk} max	146,4 mm	Maximum diameter injection pitch
E _{tk1} min	139,2 mm	Minimum diameter injection pitch
E _{tk1} max	146,4 mm	Maximum diameter injection pitch
a	49 mm	Distance between the apexes of the pressure cones

Dimensions

r _{min}	2 mm	Minimum chamfer dimension
r _{1 min}	2 mm	Minimum chamfer dimension
α	25 °	Contact angle

Temperature range

T _{min}	-30 °C	Operating temperature min.
T _{max}	100 °C	Operating temperature max.



Additional information

F_{VL}	276 N	Preload force light
F_{VM}	828 N	Preload force medium
F_{VH}	1.656 N	Preload force heavy
K_{aEL}	795 N	Lift-off force light
K_{aEM}	2.426 N	Lift-off force medium
K_{aEH}	4.942 N	Lift-off force heavy
c_{aL}	203 N/ μ m	Axial rigidity light
c_{aM}	302 N/ μ m	Axial rigidity medium
c_{aH}	392 N/ μ m	Axial rigidity heavy

Właściwości

- 

Obciążenie promieniowe
- 

Obciążenie osiowe jednokierunkowe
- 

Smarowanie smarem
- 

Smarowanie olejem
- 

Bez uszczelnienia